

AD-A107 694

PRC CONSOER TOWNSEND INC ST LOUIS MO

NATIONAL DAM SAFETY PROGRAM. BEQUETTE DAM NO NAME 262 (MO 30461--ETC(U)


JAN 79 W O SHIFRIN

DACW43-78-C-0160

NL

UNCLASSIFIED

1 04 |
AD
000000

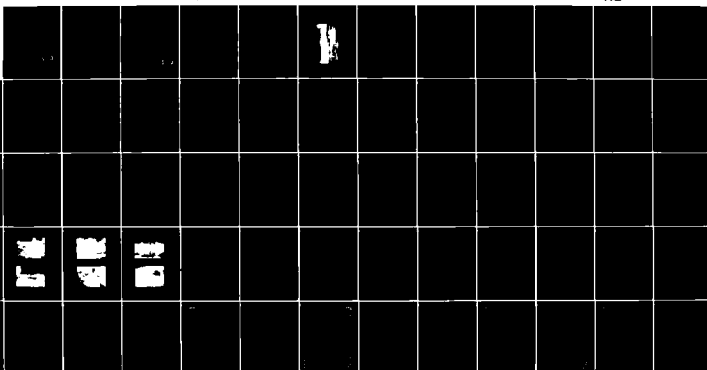

END
DATE
FEB 82
DTIC



MISSISSIPPI - KASKASKIA - ST. LOUIS BASIN

LEVEL

NO NAME 262 DAM

JEFFERSON COUNTY, MISSOURI

MO 30461

AD A107694

**PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM**



**DTIC
ELECTE
NOV 20 1981**
S D
D

PREPARED BY: U. S. ARMY ENGINEER DISTRICT, ST. LOUIS

FOR: STATE OF MISSOURI

JANUARY 1979

81 11 19 008

DISTRIBUTION STATEMENT A

Approved for public release
Distribution Unlimited

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER	2. GOVT ACCESSION NO. AD-A107694	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) Phase I Dam Inspection Report National Dam Safety Program Bequette Dam - No Name 262 (MO 30461) Jefferson County, Missouri		5. TYPE OF REPORT & PERIOD COVERED Final Report
7. AUTHOR(s) Consoer, Townsend and Associates, Ltd.		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS U.S. Army Engineer District, St. Louis Dam Inventory and Inspection Section, LMSED-PD 210 Tucker Blvd., North, St. Louis, Mo. 63101		8. CONTRACT OR GRANT NUMBER(s) DACW43-78-C-0160
11. CONTROLLING OFFICE NAME AND ADDRESS U.S. Army Engineer District, St. Louis Dam Inventory and Inspection Section, LMSED-PD 210 Tucker Blvd., North, St. Louis, Mo. 63101		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		12. REPORT DATE January 1979
		13. NUMBER OF PAGES Approximately 70
		15. SECURITY CLASS. (of this report) UNCLASSIFIED
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report) Approved for release; distribution unlimited.		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Dam Safety, Lake, Dam Inspection, Private Dams		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) This report was prepared under the National Program of Inspection of Non-Federal Dams. This report assesses the general condition of the dam with respect to safety, based on available data and on visual inspection, to determine if the dam poses hazards to human life or property.		

DD FORM 1 JAN 73 1473

EDITION OF 1 NOV 65 IS OBSOLETE

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)



DEPARTMENT OF THE ARMY
ST. LOUIS DISTRICT, CORPS OF ENGINEERS
210 NORTH 12TH STREET
ST. LOUIS, MISSOURI 63101

IN REPLY REFER TO

SUBJECT: No Name 262 Dam (Mo. 30461), Phase I Inspection Report

This report presents the results of field inspection and evaluation of No Name 262 Dam (Mo. 30461).

It was prepared under the National Program of Inspection of Non-Federal Dams.

The St. Louis District has classified this dam as unsafe because of excessively steep downstream embankment slopes as evidenced by slumping material, prevalence of seepage, and the size and extent of trees growing on the embankment.

SUBMITTED BY:

SIGNED

Chief, Engineering Division

12 MAR 1977

(Date)

APPROVED BY:

SIGNED

Colonel, CE, District Engineer

12 MAR 1977

(Date)

Accession For	
NTIS GRA&I	<input checked="checked" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A	

DTIC
ELECT
NOV 20 1981
S D

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM

Name of Dam: No Name 262 Dam, Missouri Inv. No. 30461
State Located: Missouri
County Located: Jefferson
Stream: Unnamed Tributary of Isum Creek
Date of Inspection: October 1 and 3, 1978

Assessment of General Condition

No Name 262 Dam No. Mo. 30461 was inspected using the "Recommended Guidelines for Safety Inspection of Dams". These guidelines were developed by the Chief of Engineers, U.S. Army, Washington, D.C., with the help of Federal and State agencies, professional engineering organizations, and private engineers. The resulting guidelines are considered to represent a consensus of the engineering profession.


Based on criteria in the guidelines, the dam is in the high hazard potential classification, which means that loss of life and appreciable property loss could occur in the event of failure of the dam. Four houses and three private road crossings would be subjected to flooding, with possible damage and/or destruction, and possible loss of life. No Name 262 Dam is in the small size classification since it is less than 40 feet high and impounds less than 1,000 acre-feet of water.

Our inspection and evaluation indicates that the spillway of No Name 262 Dam meets the criteria set forth in the guidelines for a dam having the above size and hazard potential. No Name 262 Dam is a small size dam with a high hazard potential required by the guidelines to pass from one-half Probable Maximum Flood to the Probable Maximum Flood without overtopping. It was determined that the spillway will pass the Probable Maximum Flood without overtopping the dam. Our evaluation indicates that the spillway will pass the 100-year flood; that is, a flood having a 1 percent chance of being equalled or exceeded during any given year.

The Probable Maximum Flood is defined as the flood discharge that may be expected from the most severe combination of critical meteorological and hydrologic conditions that are reasonably possible in the region.

Deficiencies noted by the inspection team were a need for periodic inspection by a qualified professional engineer; lack of a maintenance schedule; a need for a complete seepage and stability analyses of the dam embankment; brush and tree growth on the embankment crest and side slopes; and heavy vegetative growth on the spillway crests.

It is recommended that the owner take action to correct or control the deficiencies described above.


Walter G. Shifrin, P.E.



NONAME 262 DAM

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM

No Name 262 Dam, I.D. No. 30461

TABLE OF CONTENTS

<u>Sect. No.</u>	<u>Title</u>	<u>Page</u>
SECTION 1	PROJECT INFORMATION	1
	1.1 General	1
	1.2 Description of Project	3
	1.3 Pertinent Data	7
SECTION 2	ENGINEERING DATA	9
	2.1 Design	9
	2.2 Construction	9
	2.3 Operation	10
	2.4 Evaluation	10
SECTION 3	VISUAL INSPECTION	12
	3.1 Findings	12
	3.2 Evaluation	15
SECTION 4	OPERATION PROECEDURES	16
	4.1 Procedures	16
	4.2 Maintenance of Dam	16
	4.3 Maintenance of Operating Facilities	16
	4.4 Description of Any Warning System in Effect	17
	4.5 Evaluation	17
SECTION 5	HYDRAULIC/HYDROLOGIC	18
	5.1 Evaluation of Features	18

TABLE OF CONTENTS
(Continued)

<u>Sect. No.</u>	<u>Title</u>	<u>Page</u>
SECTION 6	STRUCTURAL STABILITY	21
	6.1 Evaluation of Structural Stability	21
SECTION 7	ASSESSMENT/REMEDIAL MEASURES	23
	7.1 Dam Assessment	23
	7.2 Remedial Measures	25

LIST OF PLATES

	<u>Plate No.</u>
LOCATION MAP	1
RELATIVE ELEVATIONS OF DAM	2
GENERAL GEOLOGIC MAP	3

APPENDICES

APPENDIX A	-	PHOTOGRAPHS TAKEN DURING INSPECTION
APPENDIX B	-	HYDROLOGIC COMPUTATIONS

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM

NO NAME 262 DAM, Missouri Inv. No. 30461

SECTION 1: PROJECT INFORMATION

1.1 General

a. Authority

The Dam Inspection Act, Public Law 92-367 of August, 1972, authorizes the Secretary of the Army, through the Corps of Engineers, to initiate a national program of dam inspections. Inspection for the No Name 262 Dam was carried out under Contract DACW 43-78-C-0160 to the Department of the Army, St. Louis District, Corps of Engineers, by the engineering firms of Consoer, Townsend & Associates Ltd., and Engineering Consultants, Inc. (A Joint Venture), of St. Louis, Missouri.

b. Purpose of Inspection

The visual inspection of the No Name 262 Dam was made on October 1, and October 3, 1978. The purpose of the inspection was to make a general assessment as to the structural integrity and operational adequacy of the dam embankment and its appurtenant structures.

c. Scope of Report

This report summarizes available pertinent data relating to the project; presents a summary of visual observations made during the field inspection; presents an evaluation of hydrologic and hydraulic conditions at the site; presents an evaluation as to the structural adequacy of the various project features; and assesses the general condition of the dam with respect to safety.

It should be noted that reference in this report to left or right abutments is as viewed looking downstream. Where left abutment or left side of the dam is used in this report, this also refers to west abutment or side, and right to the east abutment or side.

d. Evaluation Criteria

Criteria used to evaluate the dam were furnished by the Department of the Army, Office of the Chief of Engineers, in "Recommended Guidelines for Safety Inspection of Dams", Appendix D. These guidelines were developed with the help of several Federal agencies and many State agencies, professional engineering organizations, and private engineers.

1.2 Description of Project

a. Description of Dam and Appurtenances

It should be noted that design drawings are not available for the dam or appurtenant structures. The following description is based exclusively on observations and measurements made during the visual inspection.

The dam embankment is likely a homogeneous earth-fill structure. The crest of the embankment has a typical width of 8 feet and a length of 356.5 feet. The crest elevation is set at 604.5 feet above MSL, and the maximum height of the embankment is 30.5 feet above the minimum streambed elevation along the centerline of the dam.

The embankment section is constructed with side slopes of 1V to 2-1/2H upstream and 1V to 1-1/2H downstream. Riprap was not provided for protection of the upstream embankment slopes.

The embankment material was found to be sandy clay with traces of silt. The material would be classified as CL by the Unified Soil Classification System.

Bedrock at the site and within the vicinity is composed of Ordovician age sandstones with minor interbedded limestones. The gently rolling hills adjacent to the site are mantled by a residual silty, fine-grained sand, a weathered product of the bedrock. Alluvial deposits are encountered along the stream courses of the area.

The abutments for the dam are founded in the residual sands, and alluvial deposits form the foundation on which the embankment is placed. The minimal excavation for the spillway, on the west side of dam, has exposed a few thin beds of limestone within the residual sands.

Data is not available to provide a description of the foundation preparation for the dam.

There are two spillways for the No Name 262 reservoir. The service spillway is located at the left abutment of the dam embankment. This spillway consists of a trapezoidal section which has a 5 (five) foot bottom width and side slopes of 1V to 1.5H on the left bank and 1V to 1H on the right bank. A 12-inch reinforced concrete pipe is buried immediately under the trapezoidal section. The spillway discharge channel is also an unlined earth cut section with approximately the same cross section as the spillway crest. The discharge channel joins the natural stream channel near the downstream toe of the dam.

The emergency spillway is an unlined open channel located at the right abutment which has a bottom width of 21 feet and side slopes of 1V to 3H. The spillway discharge channel runs perpendicular to the dam axis and joins a natural depression about 300 feet downstream from the spillway crest.

A sketch showing the relative elevation of the dam crest and the spillway is given as a plate in this report.

No outlet structure is provided at the damsite.

The reservoir at No Name 262 Dam impounds about 35 acre-feet from a drainage of 0.039 square miles.

b. Location

No Name 262 Dam is located on an unnamed tributary of Isum Creek, Jefferson County, Missouri. The nearest community located downstream of the dam is Cedar Hill, Missouri, which is about 3 miles downstream of the lake. The dam and reservoir are shown on Belew Creek Quadrangle Sheet (7.5 minute series) in Section 20, Township 42 North, Range 4 East.

c. Size Classification

According to the "Recommended Guidelines for Safety Inspection of Dams", by the U.S. Department of the Army, Office of the Chief Engineer the dam is classified in the dam size category as being "Small" since its storage is less than 1,000 acre-feet. The dam is also classified as "Small" in dam height category because its height is less than 40 feet. The overall size classification is, accordingly, "Small" in size.

d. Hazard Classification

The dam has been classified as having "High" hazard potential in the National Inventory of Dams, on the basis that in the event of failure of the dam or its appurtenances, excessive damage could occur to downstream property, together with the possibility of the loss of life. Our findings concur with the classification. The estimated damage zone extends three miles downstream of the dam. Within the first one and one-half miles downstream of the dam are four houses and three private road crossings. It appears that these houses are

located at an elevation somewhat higher than the No Name 262 Dam reservoir. The impoundment capacity of the dam is small and, as such, no hazard to the town of Cedar Hill is expected in the event of failure of No Name 262 Dam.

e. Ownership

No Name 262 Dam is owned by Mr. Lambert C. Bequette, P. O. Box 336, Adelanto, California 92301.

f. Purpose of Dam

The purpose of the dam is for recreation and as a water supply for livestock.

g. Design and Construction History

The dam was designed and constructed in 1967 by Norman Goad, of Norman Goad Construction Company. No formal plans and specifications were made for the dam.

h. Normal Operational Procedures

The dam is used to impound water for recreational use and water supply for livestock. Water levels are controlled by the capacity of the spillway, rainfall, evaporation and runoff. There is no operation required at the reservoir, and the lake is kept as full as possible at all times.

1.3

a. Drainage Area (Acres):

25

b. Discharge at Damsite

Estimated experienced maximum flood (cfs): 160
(Estimated spillway capacity assuming 2 feet of freeboard.)

Estimated ungated spillway capacity
at maximum pool elevation (cfs): 960

c. Elevation (Feet above MSL)

Top of dam: 604.5

Spillway crest: 600.0

Minimum streambed elevation at centerline of dam: 574.0

Maximum tailwater: Unknown

d. Reservoir

Length of maximum pool (feet): 640

e. Storage (Acre-Feet)

Top of dam: 51

f. Reservoir Surface (Acres)

Top of dam: 6

Spillway crest: 3

g. Dam

Type: Earth Embankment

Length: 356.5 feet

Height (maximum): 30.5 feet

Top width: (Varies) 8 feet (typical)

Side slopes:

Downstream

1V to 1-1/2H

Upstream

1V to 2-1/2H

Zoning:

Unknown

Impervious core:

Unknown

Cutoff:

Unknown

Grout curtain:

Unknown

h. Diversion and Regulating Tunnel

None

i. Spillway

Type:

Uncontrolled

Length of weir (feet):

Service Spillway

5

Emergency Spillway

21

Crest Elevation (feet above MSL):

Service Spillway

600

Emergency Spillway

601.5

j. Regulating Outlets

None

SECTION 2: ENGINEERING DATA

2.1 Design

Design drawings are not available for the dam or appurtenant structures. The dam was designed and constructed in 1967 by Norman Goad Construction Company of House Springs, Missouri. No drawings nor designs were made for the dam or appurtenant structures.

2.2 Construction

No construction data is available for the dam and appurtenant structures.

2.3 Operation

No operation data is available for No Name 262 Dam.

2.4 Evaluation

a. Availability

No design drawings, design computations, construction data or operation data is available.

In addition, no pertinent data was available for review of hydrology spillway capacity, flood routing through the reservoir, outlet capacity, slope stability, seepage analysis, or foundation conditions.

b. Adequacy

The available engineering data is inadequate to aid in evaluating the hydraulic and hydrologic capabilities and stability of the dam for Phase I investigations.

The lack of engineering data did not allow for a definitive review and evaluation. Therefore, the adequacy of this dam could not be assessed from the standpoint of reviewing and evaluating design, operation, and construction data, but is based primarily on visual inspection, past performance history, and sound engineering judgment.

Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency. These seepage and stability analyses should be performed for appropriate loading conditions (including earthquake loads) and made a matter of record.

c. Validity

No valid engineering data is available.

SECTION 3: VISUAL INSPECTION

3.1 Findings

a. General

A visual inspection of No Name 262 Dam was made on October 1, and October 3, 1978. The following persons were present during the inspection:

<u>Name</u>	<u>Affiliation</u>	<u>Disciplines</u>
Yin Au-Yeung	Engineering Consultants, Inc.	Project Engineer, Hydraulics and Hydrology
David Bramwell	Engineering Consultants, Inc.	Geology
Jon Diebel	Engineering Consultants, Inc.	Soils
John Ismert	Engineering Consultants, Inc.	Mechanical
Kevin Blume	Consoer, Townsend & Assoc., Ltd.	Civil & Structural

Specific observations are discussed below.

b. Dam

The crest of the dam was found to have widths varying from 5 to 8 feet. A large amount of vegetation was observed on the crest, including trees and large brush.

The upstream embankment slope has a heavy vegetative cover. This vegetation again includes trees and heavy brush. One large tree 12 inches in diameter is located near the center of the dam on the upstream slope. No serious water erosion or sloughing was observed on this slope.

The downstream embankment slope appears to be generally unstable. The side slope is between 1V to 1-1.5H. Slumping is prevalent along the entire length of the dam. These slumps generally began near the crest and extend down the slope for heights of between 5 and 10 feet. Some slides extended into the dam crest, helping cause the variation in the crest width. Other slumps were seen in the embankment just above the downstream toe. The slope itself is overgrown with trees and large brush. Some trees were observed to have diameters as large as 18 inches. Minor rodent activity was also observed on the embankment.

Seepage was seen in many areas downstream of the toe of the embankment. A small flow estimated at 0.10 gpm was observed in the spillway discharge channel from seepage through the banks of the channel which runs parallel to the toe of the dam. Moist areas with some ponding water was found all along the downstream toe of the dam. This was most prevalent in the thalweg and from that area toward the right abutment. Some of the slumps on the embankment slope just above the toe of the dam are possibly caused by seepage on the slope, but heavy vegetation and rainfall in the vicinity prior to the inspection made exact determination impossible.

c. Appurtenant Structures

(1) Spillway

The service spillway crest was covered with heavy grass, brush and trees as can be seen in Photo 7 in Appendix A. The 12-inch reinforced concrete pipe was completely clogged with debris and grass. The spillway discharge channel was also covered with heavy vegetation, and exhibited very minor erosion at the bends. The

emergency spillway, which is located on the right abutment of the dam, was also covered with grass and brush, but vegetation was not as thick and dense as those on the service spillway area. It was not felt necessary to provide erosion protection measures for the dam embankment from low spillway flows.

(2) Outlet Works

No outlet works or low level drain are provided at the damsite.

d. Reservoir Area

The water level was at elevation 598.5 above MSL at the time of inspection.

The majority of the reservoir shore in the immediate area of the dam shows no sign of instability. However, there are several slumping and eroded areas at the left bank of the reservoir approximately 250 feet upstream from the service spillway. The slumping area does not appear to be of any danger to the stability of the dam and reservoir, but will increase potential sedimentation problems.

e. Downstream Channel

The downstream natural channel is well defined. Cross section of the channel is trapezoidal with bottom width of 15 feet and side slopes 1V to 2.5H on both sides. Some fallen tree trunks were noted in the channel floor.

3.2 Evaluation

The following items were observed which could affect the safety of the dam, or which will require maintenance within a reasonable period of time.

1. The generally unstable condition of the downstream embankment slope demonstrated by the extensive slumping of the embankment materials.
2. The seepage prevalent downstream of the toe of the embankment.
3. Trees and large brush growing on the crest and slopes of the dam embankment.
4. Condition of service and emergency spillways. The spillways are overgrown with brush and trees, and the concrete pipe is filled with debris.

SECTION 4: OPERATIONAL PROCEDURES

4.1 Procedures

No set policy or procedure of operation is practiced at this lake and dam. Water levels are kept as high as the spillway, rainfall, evaporation rate, and runoff will permit.

4.2 Maintenance of Dam

It is not certain if any maintenance has been performed on the dam or spillway since its construction in 1967. Several items were observed as needing maintenance and correction. All trees and large brush should be cleared from the downstream and upstream slopes. This also holds true for the channels and crests of the service and emergency spillways. The general stability of the downstream slope is questionable, and corrective measures should be taken as soon as possible.

No records are kept concerning maintenance or water levels.

4.3 Maintenance of Operating Facilities

There are no facilities at the lake which require operation or maintenance. The lake is used for recreational purposes and livestock water supply.

4.4 Description of Any Warning System in Effect

The inspection team is not aware of any existing warning system in effect.

4.5 Evaluation

Based on the condition of the dam at the time of inspection, it appears that the operation and maintenance of the damsite is inadequate. It is the opinion of the inspection team that the corrective measures outlined in Paragraph 4.2 should be implemented as soon as possible.

SECTION 5: HYDRAULIC/HYDROLOGIC

5.1 Evaluation of Features

a. Design

No hydrologic design data is available.

No Name 262 Dam has a watershed of approximately 25 acres. Land gradients in the watershed average roughly 15 percent. The lake lies on an unnamed tributary of Isum Creek.

Elevations within the watershed range from approximately 590 feet above MSL at the damsite to over 670 feet above MSL in the upper portion of the watershed.

The watershed is approximately 50 percent covered with forest, with the remainder being covered by grass and brush. A drainage map showing the watershed area is included in Appendix B.

Evaluation of the hydraulic and hydrologic features of No Name 262 Dam was based on criteria set forth in the Corps of Engineers' Recommended Guidelines for Safety Inspection of Dams, and additional guidance provided by the St. Louis District of the Corps of Engineers. The Probable Maximum Flood (PMF) was calculated from the Probable Maximum Precipitation (PMP) using the methods outlined in the U.S. Weather Bureau Publication, Hydrometeorological Report No. 33. The probable maximum storm duration was set at 24 hours, and storm rainfall distribution was based on criteria given in

EM 1110-2-1411 (Standard Project Storm). The SCS triangular hydrograph, transformed to a curvilinear hydrograph, was adopted for developing the unit hydrograph. The derived unit hydrograph is presented in Appendix B.

Initial and infiltration loss rates were applied to the PMP to obtain rainfall excesses. The rainfall excesses were then applied to the unit hydrograph to obtain the PMF hydrograph, utilizing the Corps of Engineers' computer program HEC-1 (Dam Safety Version), which was prepared specifically for dam safety analysis. The computed peak discharge of the PMF and one-half of the PMF are 756 cfs and 378 cfs, respectively.

Both the PMF and one-half of the PMF inflow hydrographs were routed through the reservoir by the Modified Puls Method, also utilizing the HEC-1 (Dam Safety Version) computer program. The peak outflow discharges for the PMF and one-half of the PMF are 345 cfs and 147 cfs, respectively. Both the PMF and one-half of the PMF, when routed through the reservoir, resulted in no overtopping of the dam.

The stage-outflow relation for the spillways were prepared from field notes and sketches. The reservoir stage-capacity data were based on the U.S.G.S. quadrangle topographic maps. Reservoir storage capacity included surcharge levels exceeding the top of the dam, and the spillway rating curve assumed that the dam remains intact during routing. In the routing computations, the discharge through the 12-inch R.C.P. was excluded due to its insignificant magnitude as compared to the spillway discharge and the PMF. The spillways and overtop rating curve and the reservoir capacity curve are also presented in Appendix B.

b. Experience Data

No records of reservoir stage or spillway discharge are maintained for this site. However, according to interviews with local residents, the maximum reservoir level was never higher than the crest of the embankment.

c. Visual Observations

No seepage was visible in the areas of the spillways. Both the service spillway and the emergency spillway need extensive clearing of brush and tree growth to maintain adequate hydraulic efficiency for the spillway in case of flood. There are no drawdown facilities to evacuate the reservoir. The spillway and exit channel for both the spillways are located at the furthestmost abutments, and releases from the spillways will not pose danger to the integrity of the dam.

d. Overtopping Potential

As indicated in Section 5.1-a., both the Probable Maximum Flood and one-half of the Probable Maximum Flood, when routed through the reservoir, resulted in no overtopping of the dam. The PMF and one-half of the PMF, when routed through the reservoir has freeboards of 1.09 feet and 2.19 feet, respectively. The spillways of the No Name 262 Dam are capable of passing a flood equal to the PMF with over 1 foot of freeboard. The magnitude of the peak is about eight times larger than a 100-year frequency flood peak. Since one-half of the PMF is the minimum Spillway Design Flood (SDF) for No Name 262 Dam, according to the Recommended Guidelines for Safety Inspection of Dams by the Corps, the spillway capacity of the dam is considered "Adequate".

SECTION 6: STRUCTURAL STABILITY

6.1 Evaluation of Structural Stability

a. Visual Observations

The downstream embankment slope appears to be unstable. The slope is as steep as 1V to 1H in places, which is not felt to be a satisfactory slope for the material used for the embankment. The prevalent slumping is an indication of an unstable cross-section.

The seepage prevalent downstream of the toe of the dam, and possibly on the embankment slope, is a further condition indicating a potential hazard. Seepage can reduce stability of the downstream slope and/or may lead to piping (internal erosion).

The extensive brush and tree growth present on the crest and side slopes could eventually pose a hazard to the embankment. This heavy vegetation prevents proper inspection of the dam embankment, including identification of moisture and seepage, in addition to the problems inherent with trees allowed to grow on dam embankments.

No sign of structural instability or distress was observed on either spillway. However, there was minor erosion on the bends of the service spillway discharge channel. This area will probably require some reshaping and repair following a major flood.

b. Design and Construction Data

No design or construction data relating to the structural stability of the dam or appurtenant structures was found.

c. Operating Records

No operating records are available relating to the stability of the dam or appurtenant structures. Water levels have not been recorded, however, the reservoir is assumed to be close to full at all times. No operating facilities exist at the damsite.

d. Post Construction Changes

No post construction changes are known which will affect the structural stability of the dam.

e. Seismic Stability

In general projects located in Seismic Zones 0, 1 and 2 can be assumed to present no hazard from earthquake, provided the static stability conditions are satisfactory and conventional safety margins exist. No Name 262 Dam is located in Seismic Zone 1. A detailed seismic analysis is not felt to be necessary for this embankment.

SECTION 7: ASSESSMENT/REMEDIAL MEASURES

7.1 Dam Assessment

The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigations, testing, and detailed computational evaluations are beyond the scope of a Phase I investigation; however, the investigation is intended to identify any need for such studies.

It should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team.

It is also important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through continued care and inspection can there be any chance that an unsafe condition could be detected.

a. Safety

The capacity of the spillways of No Name 262 Dam were found to be adequate to safely pass the PMF. However, the overall structural condition of the dam embankment is questionable. The constructed cross-section is not in compliance with what would normally be considered as an acceptable design. The 1V to 1-1/2H downstream slope is very steep, even for a dam 30 feet high. The slopes are generally uneven and irregular, and the crest width varies considerably. The

extensive slumping on the downstream slope is indicative of an unstable slope. No data indicating construction techniques, embankment material or foundation conditions and treatment is available, however, the extensive seepage appearing downstream of the embankment toe indicates that foundation preparation may not have been satisfactory. A stability study should be done by a professional engineer experienced in design and construction of earthfill dams, to determine the stability of the embankment.

The heavy brush and tree growth on the embankment slopes pose a potential hazard to the dam. The extensive tree growth is considered unsatisfactory in terms of dam safety for several reasons: First, trees toppled by wind expose holes that invite rapid erosion, and second, decay of large existing root systems could form channels for eventual piping.

The heavy vegetative growth on the service and emergency spillway crests inhibit the hydraulic efficiency of these structures. Clearing of this vegetation and preventing future growth should be undertaken.

The spillways and the exit channels are located at the two abutments. Low flows through the spillways should not pose danger to the dam embankment.

b. Adequacy of Information

Information concerning the dam and appurtenant structures is not available. It is recommended that the following programs be initiated to help alleviate this problem:

1. Periodic inspection of the dam by a professional engineer experienced in the design and construction of earthen dams should be made, and this inspection report made a matter of record.
 2. Set up a maintenance schedule and log all visits to the dam for repairs and maintenance.
- c. Urgency

The remedial measures recommended in Paragraph 7.2 should be accomplished in the near future.

The stability analysis of the embankment is of more urgent nature than the other recommended actions.

d. Necessity for Phase II Inspection

Based on results of the Phase I inspection, and if the remedial measures recommended in Paragraph 7.2 are undertaken as soon as possible, a Phase II inspection is not felt to be necessary.

7.2 Remedial Measures

- a. A complete stability study of the dam embankment should be undertaken as soon as possible. This study should evaluate the structural stability of the embankment section under maximum loading conditions. Due to the lack of data available, the study must include some test holes and piezo-meter installations. Information concerning foundation materials, soil properties of the embankment materials, and

data on the phreatic line is necessary to adequately assess the embankments structural stability under all conditions.


b. The crest and embankment slopes, as well as the spillway crests, should be cleared of all trees and large brush. Because of the size and extent of trees, coupled with the apparent instability, clearing should be done under the guidance of a professional engineer. Indiscriminate clearing methods could create an unsafe situation.


c. O & M Maintenance Procedures

The owner should initiate the following programs:

1. Periodic inspection of the dam by a professional engineer experienced in the design and construction of earthen dams.
2. Set up a maintenance schedule and log all visits to the dam for repairs and maintenance.
3. Clear the heavy vegetative growth from the crests of the service and emergency spillways. The concrete pipe in the service spillway should also be unplugged.

PLATES

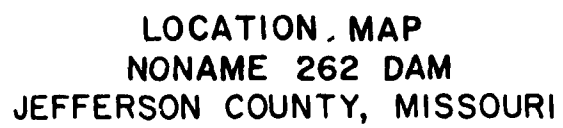

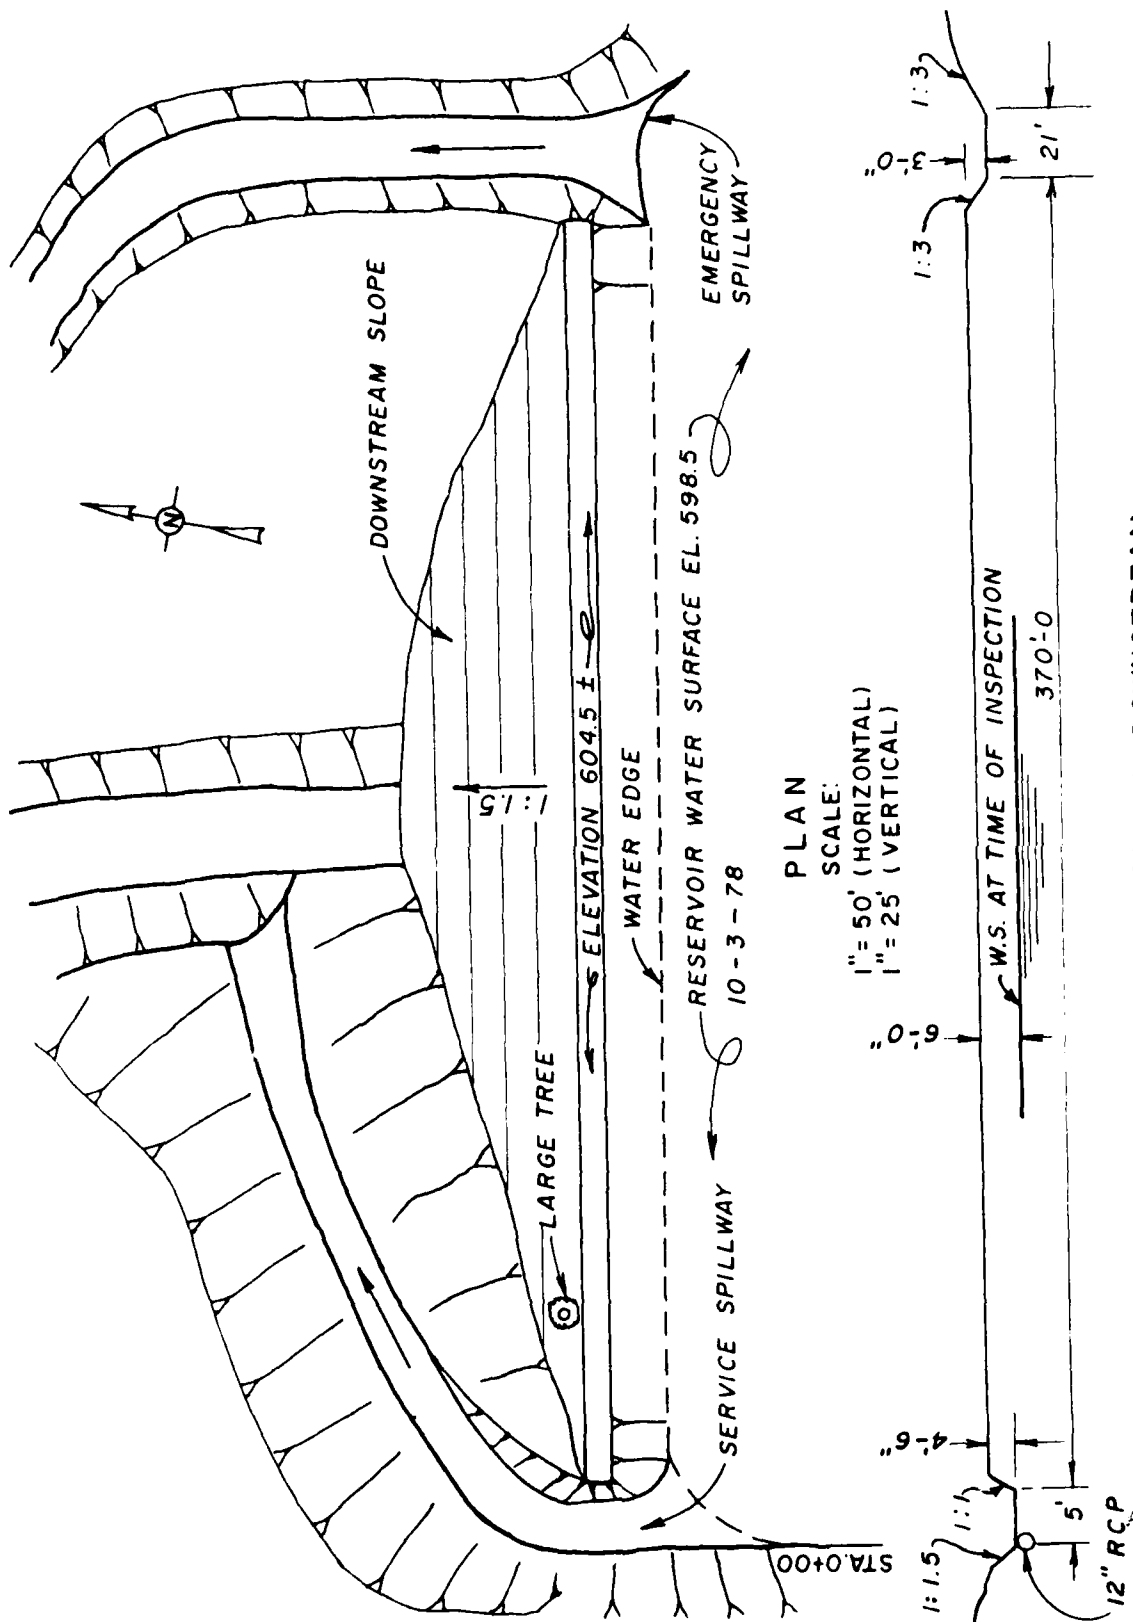

NONAME 262 DAM
RELATIVE ELEVATIONS


PLAN

SCALE:

1" = 50' (HORIZONTAL)

1" = 25' (VERTICAL)

ELEVATION - LOOKING DOWNSTREAM

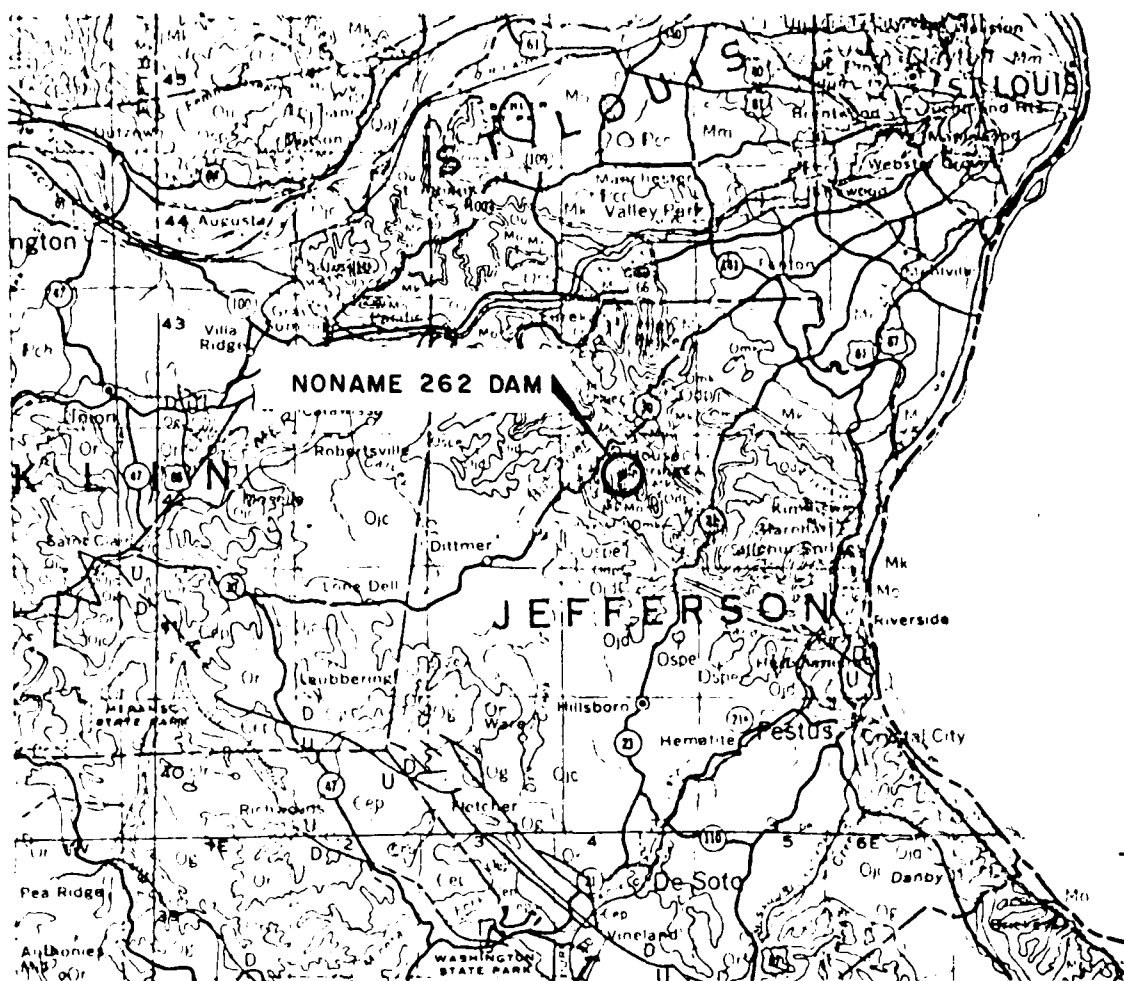

General Geologic Map

Explanation

Mississippian System

M_o - cherty and crinoidal limestone, with some shale.

M_k - intercalated limestones and shales.

Ordovician System

O_{mk} - shale and limestone.

O_{dp} - shale with thin fossiliferous limestone beds and dense limestone.

O_{jd} - dolomite with interbedded limestone, shale, and black limestone.

O_{spe} - massive, cross-bedded sandstone; and dolomite, lithographic limestone with interbedded sandstone.

O_{jc} - silty and cherty dolomite with oolitic chert.

O_r - sandstone, chert, and interbedded dolomite.

O_g - cherty dolomite with a basal sandstone.

Reference: Geologic Map of Missouri, 1961, Division of Geological Survey and Water Resources, State of Missouri.

APPENDIX A
PHOTOGRAPHS TAKEN DURING INSPECTION

NO NAME 262 DAM

- Photo 1 - View along crest of dam embankment taken at left abutment.
- Photo 2 - View along upstream slope of embankment taken at left abutment.
- Photo 3 - View of upstream slope of embankment taken at right abutment.
- Photo 4 - Picture of typical section of downstream embankment slope.
- Photo 5 - Picture of spillway channel at right side of dam looking downstream.
- Photo 6 - Picture of spillway channel at right side of dam looking downstream toward lake.
- Photo 7 - Picture of spillway channel at left side of dam looking downstream.
- Photo 8 - Picture of concrete pipe in spillway channel at left side of dam.
- Photo 9 - Picture of left bank of reservoir. Note sloughing and erosion of bank.
- Photo 10 - Close-up of slumping area at left bank of reservoir.



Photo 1 - View along crest of dam embankment taken at left abutment.



Photo 2 - View along upstream slope of embankment taken at left abutment.



Photo 3 - View of upstream slope of embankment taken at right abutment.



Photo 4 - Picture of typical section of downstream embankment slope.



Photo 5 - Picture of spillway channel at right side of dam looking downstream.



Photo 6 - Picture of spillway channel at right side of dam looking downstream toward lake.



Photo 7 - Picture of spillway channel at left side of dam looking downstream.



Photo 8 - Picture of concrete pipe in spillway channel at left side of dam.

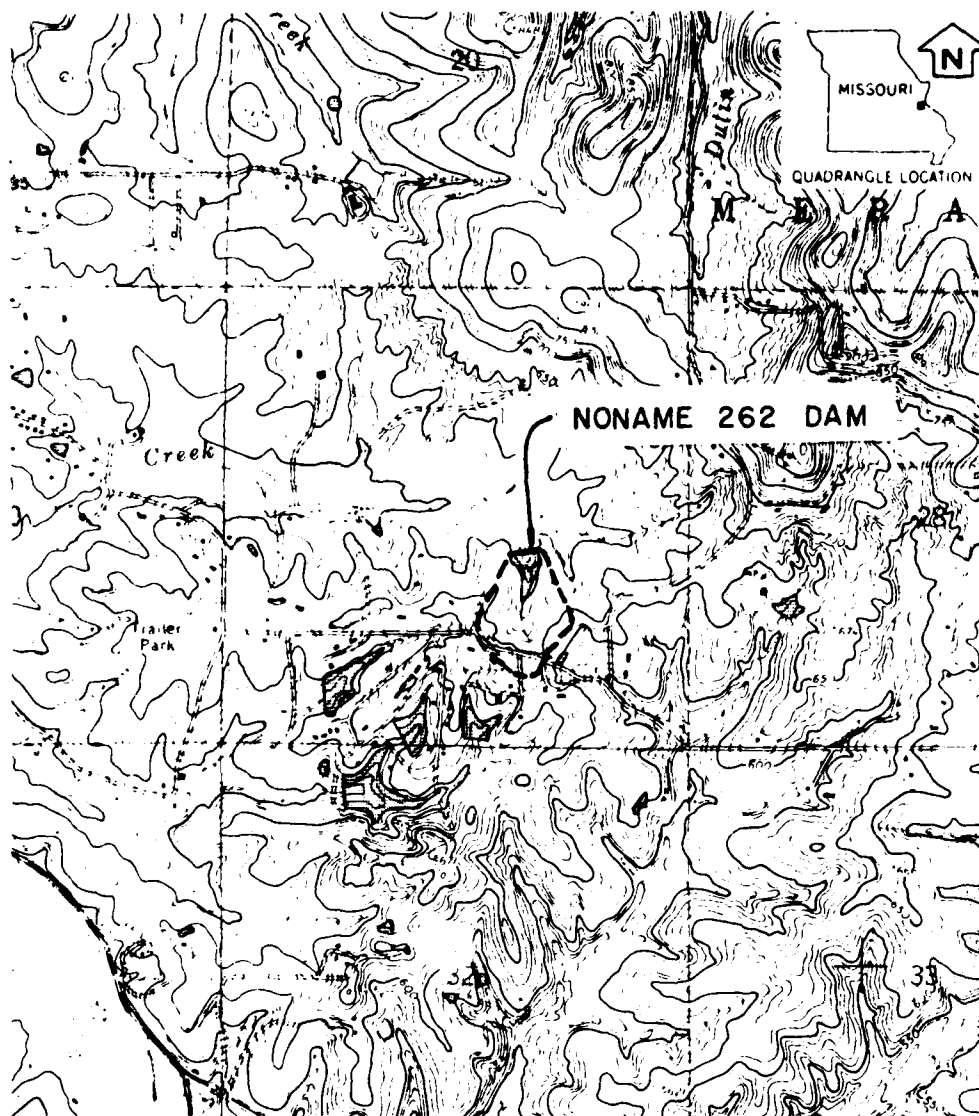


Photo 9 - Picture of left bank of reservoir. Note sloughing and erosion of bank.

 


Photo 10 - Close-up of slumping area at left bank of reservoir.

APPENDIX B
HYDROLOGIC COMPUTATIONS



SCALE 1:24,000



CONTOUR INTERVAL 10 FEET
NATIONAL GEODETIC VERTICAL DATUM OF 1929
DRAINAGE BOUNDARY — — — — —

**NONAME 262 DAM
DRAINAGE BASIN**

ENGINEERING CONSULTANTS, INC.

DAM SAFETY INSPECTION - MISSOURI

NO NAME 262 DAM

RESERVOIR AREA CAPACITY DATA

SHEET NO. 1 OF

JOB NO. 1223-001-1

BY KLB DATE 11-16-78

Lin


NO NAME 262 DAM

RESERVOIR AREA CAPACITY DATA

ELEVATION FT.	RESERVOIR SURFACE AREA (ACRES)	INCREMENTAL VOLUME (AC-FT)	TOTAL VOLUME (AC-FT)	REMARKS
574	0	-	0	
600	3	31	31**	ASSUMED SPINNAY CREST ELEVATION
604.5	5.8*	19.8	50.8	TOP OF DAM ELEVATION
610	9	40.7	91.5	AREA MEASURED ON U.S.G.S. MAP
620	13	110.0	201.5	AREA MEASURED ON U.S.G.S. MAP

* INTERPOLATED DATA

** DATA FROM INVENTORY SHEET

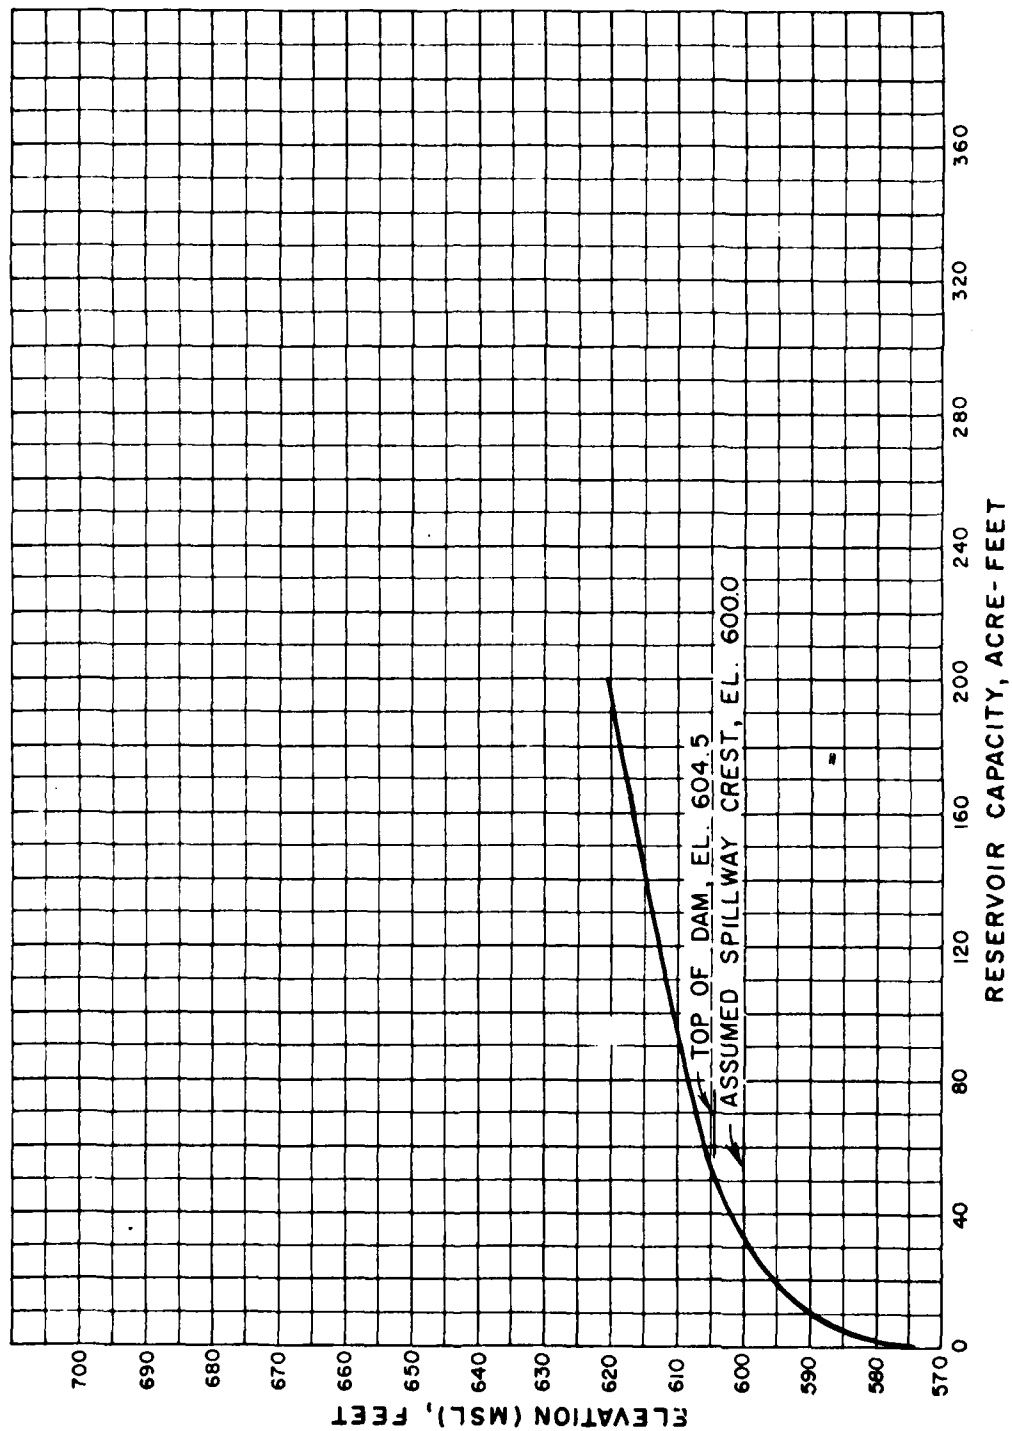

NONAME 262 DAM
RESERVOIR CAPACITY CURVE

ENGINEERING CONSULTANTS, INC.

DAM SAFETY INSPECTION - MISSOURI


NO NAME 262 DAM

SPILLWAY AND OVERTOP DISCHARGE CAPACITY


SHEET NO. 1 OF 2

JOB NO. 1223-001

BY HLB DATE 11-30-71

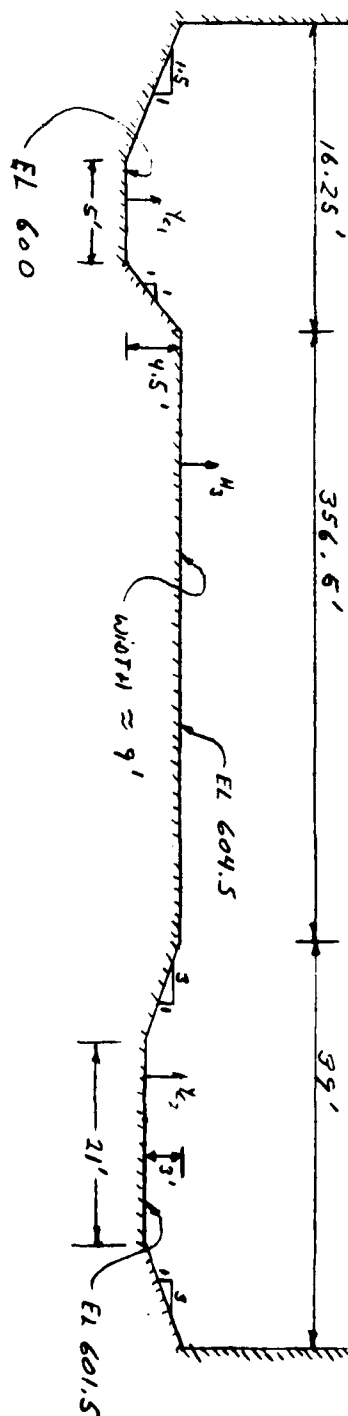

K_1	T_1	A_1	$K_1 = \frac{5.67}{\sqrt{K_1}}$	$K_2 = \frac{Q_1}{A_1 K_1}$	$Q_1 = \frac{4.5 W.S. EL = 600 + K_1 + K_2}{2g}$	A_{K2}	T_2	$A_{K2} = \frac{5.67}{\sqrt{K_2}}$	$Q_2 = A_{K2} K_2$	H_3	C_3	L_3	Q_3	$Q_T = Q_1 + Q_2 + Q_3$
1.0	7.5	6.25	5.18	0.92	32	601.42								32
2.0	10.0	15.0	6.74	0.75	104	602.75	0.83	25.78	19.92	4.96	79			203
3.0	12.5	28.25	8.22	1.05	216	604.05	1.70	31.20	40.80	6.48	265			481
3.5	13.75	32.81	8.76	1.19	287	604.69	2.13	33.76	51.12	6.98	357			718
4.0	15.0	40.0	9.26	1.33	370	605.33	2.55	36.30	61.20	7.36	451			1179
4.5	16.25	47.81	9.73	1.47	465	605.97	2.98	38.80	71.52	7.69	550			2692

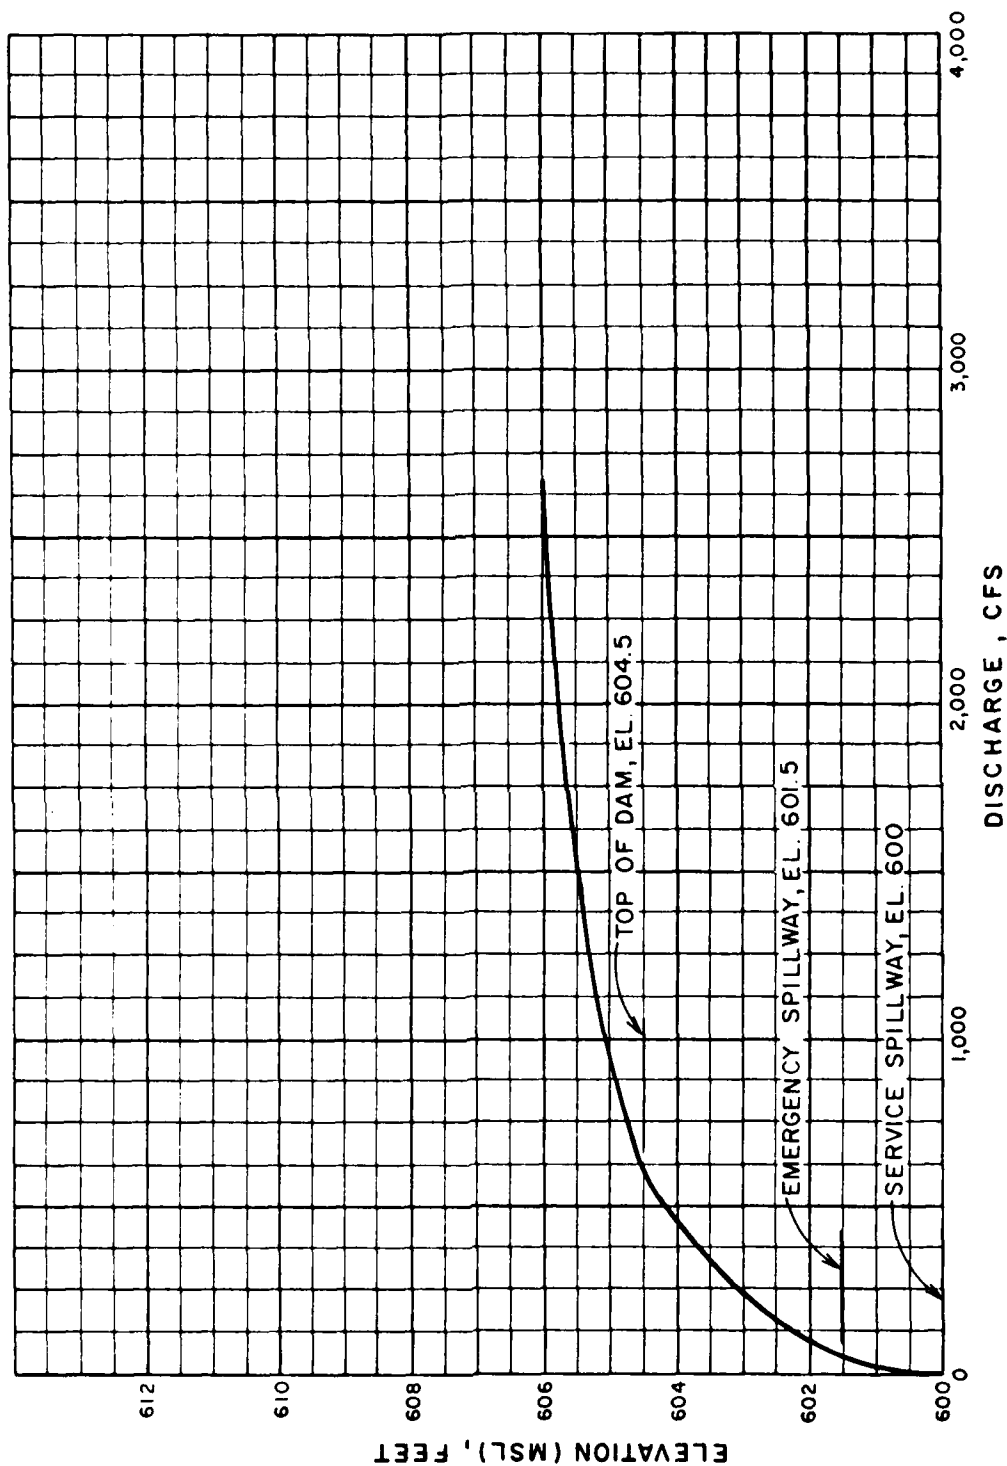

NONAME 262 DAM
SPILLWAY & OVERTOP RATING
CURVE

ENGINEERING CONSULTANTS, INC.

DAM SAFETY INSPECTION - MISSOURI

SHEET NO. 1 OF 3

NONAME 262 DAM

JOB NO. 1228-001-1

UNIT HYDROGRAPH PARAMETERS

BY KLB DATE 11-6-78

Lin

1 DRAINAGE AREA = 25 ACRES = 0.039 SQ. MI.

2. LENGTH OF STREAM, $L = 0.4 \times 2200' / 5280 = 0.152$ MI.

3 DIFFERENCE IN ELEV., $\Delta H = 677 - 600 = 77$ FT.

4. TIME OF CONCENTRATION

$$T_c = \left(\frac{11.9 \times L^3}{\Delta H} \right)^{0.385}$$

$$T_c = \left(\frac{11.9 \times 0.152^3}{77} \right)^{0.385}$$

$$T_c = 0.055 \text{ HR}$$

5. LAG TIME, $L_t = 0.6 \times T_c$

$$L_t = 0.6 \times 0.055 = 0.033 \text{ HR}$$

6. RAINFALL UNIT DURATION

$$D \pm \frac{L_t}{4} = \frac{0.033}{4} = 0.008 \text{ HR}$$

$$\text{USE } D = 5 \text{ MIN} = 0.083 \text{ HR}$$

MINIMUM DURATION CRITERIA.

7. TIME TO PEAK, T_p

$$T_p = \frac{D}{2} + 0.6 \times T_c$$

$$T_p = \frac{0.083}{2} + 0.6 \times 0.055 = 0.075 \text{ HR}$$

$$8 \quad q_p = \frac{484 \times A}{T_p} = \frac{484 \times 0.039}{0.075} = 252 \text{ CFS}$$

ENGINEERING CONSULTANTS, INC.

DAM SAFETY INSPECTION - MISSOURI

SHEET NO. 2 OF 3

NO NAME 262 DAM

JOB NO. 1223-001-1


UNIT HYDROGRAPH DERIVATION

BY KLB DATE 11-6-78

lim

9) CURVILINEAR UNIT HYDROGRAPH

TIME T/T_p	DISCHARGE RATIO q/q_p	UNIT HYDROGRAPH	
		TIME, T (HR)	DISCHARGE (CFS)
0.000	0.000	0.000	0.000
0.1	0.015	0.008	3.78
0.2	0.075	0.015	18.90
0.3	0.16	0.023	40.32
0.4	0.28	0.030	70.56
0.5	0.45	0.038	113.40
0.6	0.60	0.045	151.20
0.7	0.77	0.053	194.04
0.8	0.89	0.060	224.28
0.9	0.97	0.068	244.44
1.0	1.00	0.075	252.00
1.1	0.98	0.083	246.96
1.2	0.92	0.090	231.84
1.3	0.84	0.098	211.68
1.4	0.75	0.105	189.00
1.5	0.66	0.113	166.32
1.6	0.56	0.120	141.12
1.8	0.42	0.135	105.84
2.0	0.32	0.150	80.64
2.2	0.24	0.165	60.48
2.4	0.18	0.180	45.36
2.6	0.13	0.195	32.76
2.8	0.098	0.210	24.70
3.0	0.075	0.225	18.90
3.5	0.036	0.263	7.07
4.0	0.018	0.300	4.54
4.5	0.009	0.338	2.27
5.0	0.004	0.375	1.01

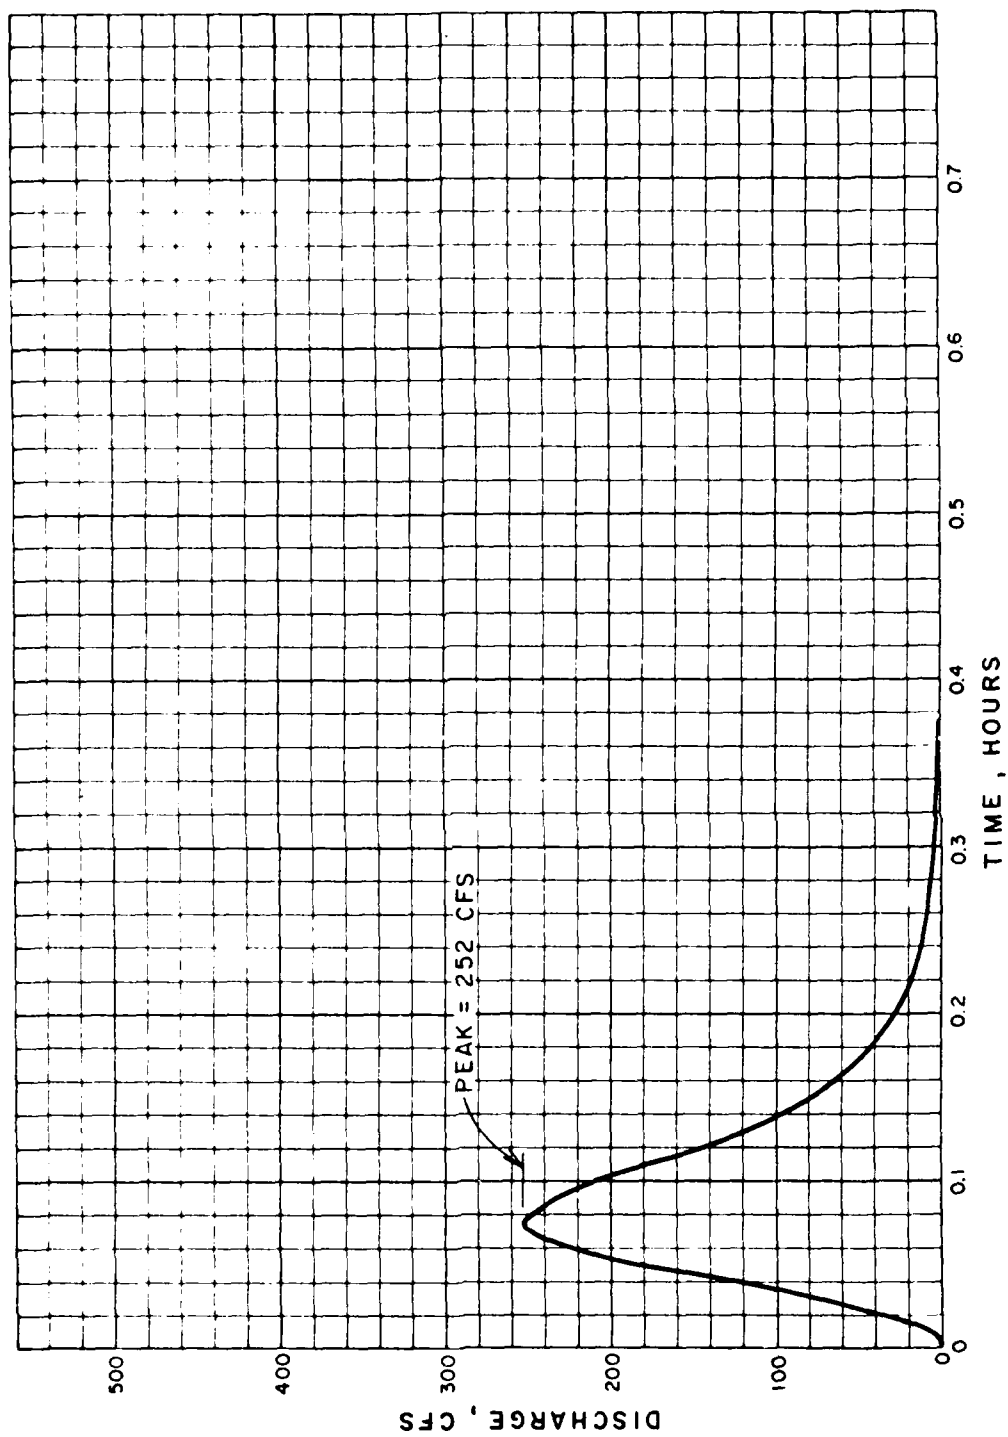

NONAME 262 DAM
5 MINUTE UNIT HYDROGRAPH

ENGINEERING CONSULTANTS, INC.

DAM SAFETY INSPECTION/MISSOURI

NONAME 262 DAM

PROBABLE MAXIMUM STORM (PMS)

SHEET NO. 1 OF 2

JOB NO. 1223-001

BY MAS DATE 11/20/78

Lin

DETERMINATION OF PMS

1. Determine drainage area of the basin

D. A. = 25 acres = 0.039 sq. mi.

2. Determine PMP Index rainfall:

Location of Centroid of basin:

Long. 90°59'7"; Lat. 38°34'5"

→ PMP for 200 sq. mi. & 24 hrs duration


= 25.5" (from Fig 1, HMR NO 33)

3. Determine basin rainfall in terms of percentage of PMP Index rainfall for various durations:

Location: Long. 90°59'7"; Lat. 38°34'5"

⇒ Zone 7

Duration (Hrs.)	Percent of Index rainfall (%)	Total rainfall (Inches)	Rainfall increments (Inches)	Duration of incre- ment (Hrs.)
6	100	25.5	25.5	6
12	120	30.6	5.1	6
24	130	33.2	2.6	12

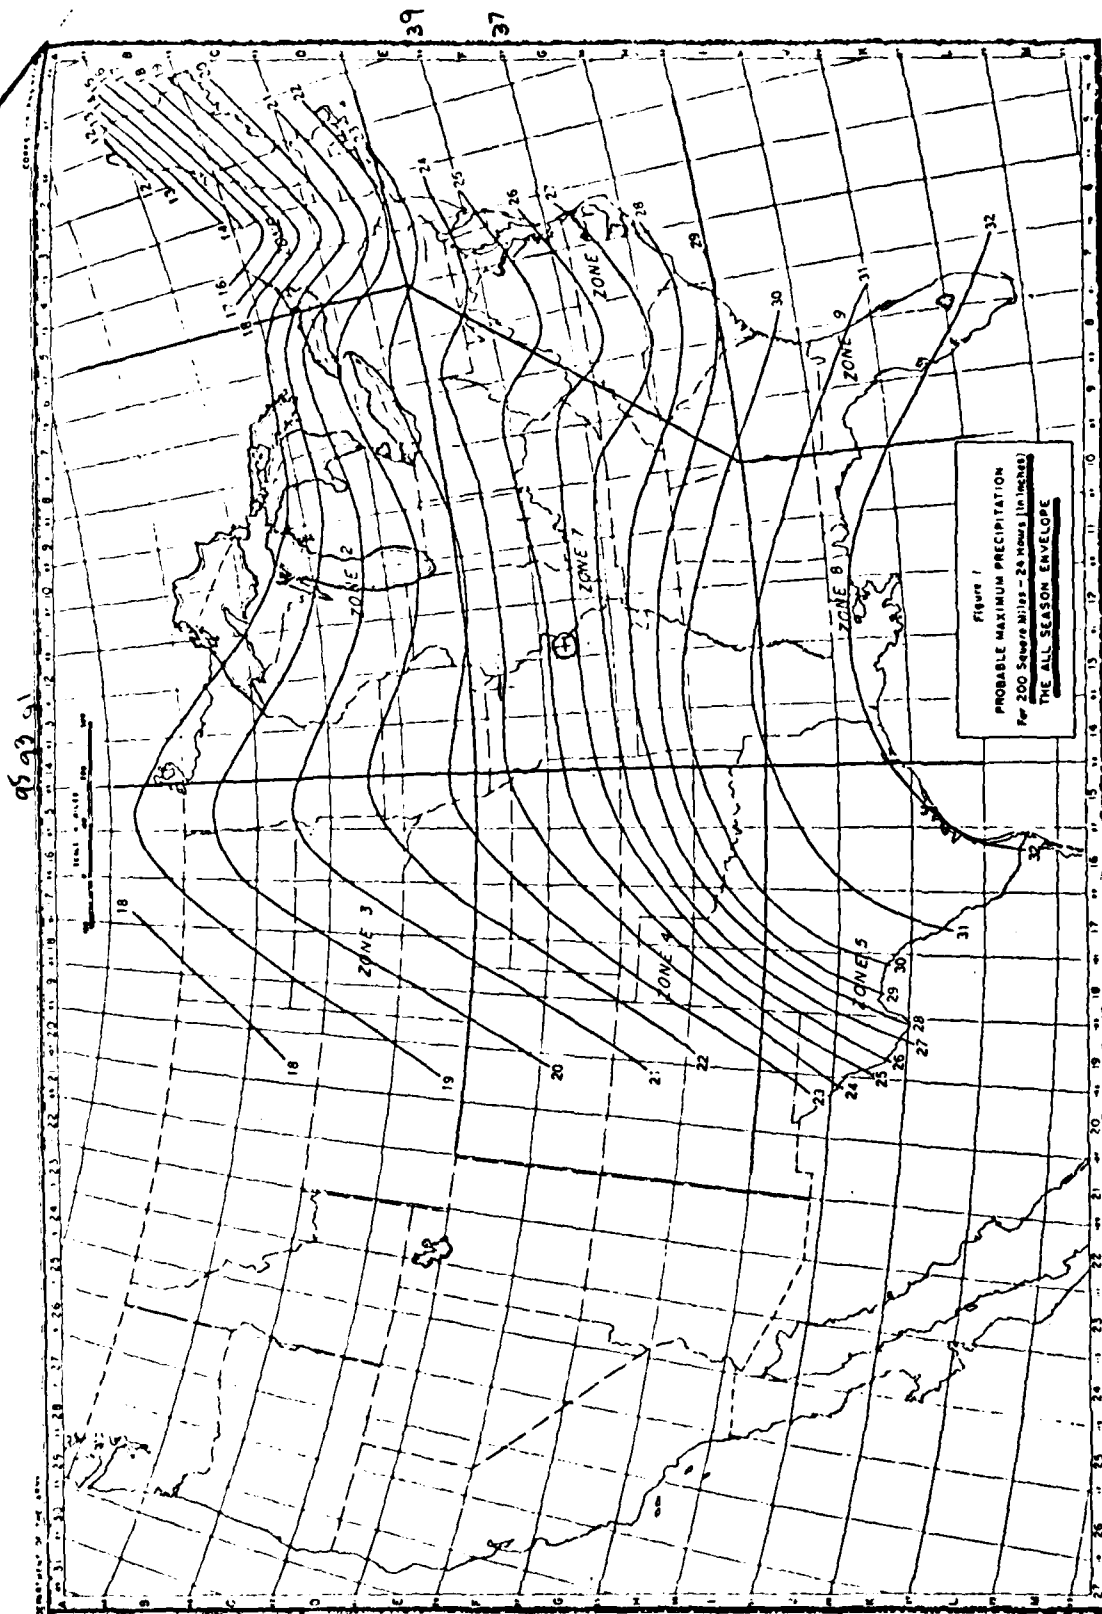

25.5"
NONAME 262 DAM
DETERMINATION OF PMP

ENGINEERING CONSULTANTS, INC.

DAM SAFETY INSPECTION - MISSOURI

NONAME 262 DAM

100 YEAR FLOOD BY REGRESSION EQUATION

SHEET NO. 1 OF 1

JOB NO. 1223-001-1

BY KLB DATE 11-20-78

Um

NO NAME 262 DAM

100 YEAR FLOOD BY REGRESSION EQUATION

REGRESSION EQUATION FOR 100 YEAR FLOOD FOR

MISSOURI:

$$Q_{100} = 85.1 A^{0.934} S^{-0.02} L^{0.576}$$

WHERE

A = DRAINAGE AREA IN SQ. MI.

S = MAIN CHANNEL SLOPE, FT/MI

(AVG. SLOPE BETWEEN 0.1 L AND 0.85 L,
L, BEING LENGTH OF MAIN STREAM)

FOR NO NAME 262 DAM

$$A = 0.039 \text{ SQ. MI.}$$

$$S = \frac{648 - 600 \text{ ft}}{0.75 \times 0.152 \text{ mi}} \times \frac{40}{0.11} = 350.88 \text{ ft/mi}$$

$$Q_{100} = 85.1 (0.039)^{0.934} (0.039)^{-0.02} (350.88)^{0.576}$$

$$= \underline{\underline{98 \text{ CFS}}}$$

HEC10B INPUT DATA

Line

PREVIEW OF SEQUENCE OF STREAM NETWORK CALCULATIONS

17
17
RINDEL HYDROGRAPH AT
ROUTE HYDROGRAPH TO
END OF NETWORK

INFLOW PMF AND ONE-HALF PMF HYDROGRAPHS

QUN DATE: 78/11/30.
TIME: 18.29.37.

DATA SAFETY INFORMATION - DISCOUNT
NORAMF 202 CAP
DUE AND 50 PERCENT DUE DETERMINATION 4.00 PERCENT

JOB SPECIFICATION					
JOB	UNIT	LAY	TIME	METER	VINT VSTAN Q
	5		0	0	0
		UNDE	UNIT	TRACT	0
		5	0	0	0

```

MULTIPLY: 0.41948 TO ME 1108.10000
MF1A=1 MULTI=2 MULTI=1
.5)
MULTIPLY: 0.41948 TO ME 1108.10000
MF1A=1 MULTI=2 MULTI=1
.5)

```

```

*****          *****          *****
SUB-AREA 4: DUFF COMBINATION

INPUT PWD   INTR PRECIPITATION AND RATIOS, INPUT SYS UN?
ISTAC      ICOMP      ITEMP      ITYPE      JDAY      JSTRT      INAME      ISTAGE      IAUTH
17         C           0           0           0           0           1           0           0

```

MWD:	I
T MG	-1
TAIFA	.04
SAP	0.00
HYDROGRAPH DATA	
HSDA	TPSP
.04	1.00
RATN	0.000
:XND	0
ISAME	0
LOCAL	0

LOSS DATA						
STORY	CLTDR	WTOL	FRAM	STMS	WTDM	STPL
0	0.00	1.00	0.00	0.00	1.00	0.00
1	0.00	1.00	0.00	0.00	1.00	0.00
2	0.00	1.00	0.00	0.00	1.00	0.00
3	0.00	1.00	0.00	0.00	1.00	0.00
4	0.00	1.00	0.00	0.00	1.00	0.00
5	0.00	1.00	0.00	0.00	1.00	0.00
6	0.00	1.00	0.00	0.00	1.00	0.00
7	0.00	1.00	0.00	0.00	1.00	0.00
8	0.00	1.00	0.00	0.00	1.00	0.00
9	0.00	1.00	0.00	0.00	1.00	0.00
10	0.00	1.00	0.00	0.00	1.00	0.00
11	0.00	1.00	0.00	0.00	1.00	0.00
12	0.00	1.00	0.00	0.00	1.00	0.00
13	0.00	1.00	0.00	0.00	1.00	0.00
14	0.00	1.00	0.00	0.00	1.00	0.00
15	0.00	1.00	0.00	0.00	1.00	0.00
16	0.00	1.00	0.00	0.00	1.00	0.00
17	0.00	1.00	0.00	0.00	1.00	0.00
18	0.00	1.00	0.00	0.00	1.00	0.00
19	0.00	1.00	0.00	0.00	1.00	0.00
20	0.00	1.00	0.00	0.00	1.00	0.00
21	0.00	1.00	0.00	0.00	1.00	0.00
22	0.00	1.00	0.00	0.00	1.00	0.00
23	0.00	1.00	0.00	0.00	1.00	0.00
24	0.00	1.00	0.00	0.00	1.00	0.00
25	0.00	1.00	0.00	0.00	1.00	0.00
26	0.00	1.00	0.00	0.00	1.00	0.00
27	0.00	1.00	0.00	0.00	1.00	0.00
28	0.00	1.00	0.00	0.00	1.00	0.00
29	0.00	1.00	0.00	0.00	1.00	0.00
30	0.00	1.00	0.00	0.00	1.00	0.00
31	0.00	1.00	0.00	0.00	1.00	0.00
32	0.00	1.00	0.00	0.00	1.00	0.00
33	0.00	1.00	0.00	0.00	1.00	0.00
34	0.00	1.00	0.00	0.00	1.00	0.00
35	0.00	1.00	0.00	0.00	1.00	0.00
36	0.00	1.00	0.00	0.00	1.00	0.00
37	0.00	1.00	0.00	0.00	1.00	0.00
38	0.00	1.00	0.00	0.00	1.00	0.00
39	0.00	1.00	0.00	0.00	1.00	0.00
40	0.00	1.00	0.00	0.00	1.00	0.00
41	0.00	1.00	0.00	0.00	1.00	0.00
42	0.00	1.00	0.00	0.00	1.00	0.00
43	0.00	1.00	0.00	0.00	1.00	0.00
44	0.00	1.00	0.00	0.00	1.00	0.00
45	0.00	1.00	0.00	0.00	1.00	0.00
46	0.00	1.00	0.00	0.00	1.00	0.00
47	0.00	1.00	0.00	0.00	1.00	0.00
48	0.00	1.00	0.00	0.00	1.00	0.00
49	0.00	1.00	0.00	0.00	1.00	0.00
50	0.00	1.00	0.00	0.00	1.00	0.00
51	0.00	1.00	0.00	0.00	1.00	0.00
52	0.00	1.00	0.00	0.00	1.00	0.00
53	0.00	1.00				

0. 252. 42. GIVEN UNIT GRAPH, NUMGOM= 5
UNIT GRAPH TOTALS 1. 301. CFS OR 1.00 INCHES OVER THE AREA

```

STATUS= 0.00 REPRESSION DATA
          OPGCNS 0.00 RYJORS 1.00

```

MO, DA	HR, MN	PERIOD	RAIN	ETCS	LUSS	COMP 0	PERIOD FLOW	MO, DA	HR, MN	PERIOD	RAIN	ETCS	LOSS	COMP 0
1.01	.05	1	.01	0.00	.01	0.	1.01	12.35	151	.21	.21	.01	.02.	
1.01	.10	2	.01	0.00	.01	0.	1.01	12.40	152	.21	.21	.01	.02.	

1.01	5.15	63	.01	0.00	.01	0.00	.01	17.45	213	.25	.23	.01	88
1.01	5.20	64	.01	0.00	.01	0.00	.01	17.50	214	.25	.23	.01	88
1.01	5.25	65	.01	0.00	.01	0.00	.01	17.55	215	.25	.23	.01	88
1.01	5.30	66	.01	0.00	.01	0.00	.01	18.00	216	.25	.23	.01	88
1.01	5.35	67	.01	0.00	.01	0.00	.01	18.05	217	.25	.23	.01	88
1.01	5.40	68	.01	0.00	.01	0.00	.01	18.10	218	.25	.23	.01	88
1.01	5.45	69	.01	0.00	.01	0.00	.01	18.15	219	.25	.23	.01	88
1.01	5.50	70	.01	0.00	.01	0.00	.01	18.20	220	.25	.23	.01	88
1.01	5.55	71	.01	0.00	.01	0.00	.01	18.25	221	.25	.23	.01	88
1.01	5.60	72	.01	0.00	.01	0.00	.01	18.30	222	.25	.23	.01	88
1.01	5.65	73	.01	0.00	.01	0.00	.01	18.35	223	.25	.23	.01	88
1.01	5.70	74	.01	0.00	.01	0.00	.01	18.40	224	.25	.23	.01	88
1.01	5.75	75	.01	0.00	.01	0.00	.01	18.45	225	.25	.23	.01	88
1.01	5.80	76	.01	0.00	.01	0.00	.01	18.50	226	.25	.23	.01	88
1.01	5.85	77	.01	0.00	.01	0.00	.01	18.55	227	.25	.23	.01	88
1.01	5.90	78	.01	0.00	.01	0.00	.01	19.00	228	.25	.23	.01	88
1.01	5.95	79	.01	0.00	.01	0.00	.01	19.05	229	.25	.23	.01	88
1.01	6.00	80	.01	0.00	.01	0.00	.01	19.10	230	.25	.23	.01	88
1.01	6.05	81	.01	0.00	.01	0.00	.01	19.15	231	.25	.23	.01	88
1.01	6.10	82	.01	0.00	.01	0.00	.01	19.20	232	.25	.23	.01	88
1.01	6.15	83	.01	0.00	.01	0.00	.01	19.25	233	.25	.23	.01	88
1.01	6.20	84	.01	0.00	.01	0.00	.01	19.30	234	.25	.23	.01	88
1.01	6.25	85	.01	0.00	.01	0.00	.01	19.35	235	.25	.23	.01	88
1.01	6.30	86	.01	0.00	.01	0.00	.01	19.40	236	.25	.23	.01	88
1.01	6.35	87	.01	0.00	.01	0.00	.01	19.45	237	.25	.23	.01	88
1.01	6.40	88	.01	0.00	.01	0.00	.01	19.50	238	.25	.23	.01	88
1.01	6.45	89	.01	0.00	.01	0.00	.01	19.55	239	.25	.23	.01	88
1.01	6.50	90	.01	0.00	.01	0.00	.01	20.00	240	.25	.23	.01	88
1.01	6.55	91	.01	0.00	.01	0.00	.01	20.05	241	.25	.23	.01	88
1.01	6.60	92	.01	0.00	.01	0.00	.01	20.10	242	.25	.23	.01	88
1.01	6.65	93	.01	0.00	.01	0.00	.01	20.15	243	.25	.23	.01	88
1.01	6.70	94	.01	0.00	.01	0.00	.01	20.20	244	.25	.23	.01	88
1.01	6.75	95	.01	0.00	.01	0.00	.01	20.25	245	.25	.23	.01	88
1.01	6.80	96	.01	0.00	.01	0.00	.01	20.30	246	.25	.23	.01	88
1.01	6.85	97	.01	0.00	.01	0.00	.01	20.35	247	.25	.23	.01	88
1.01	6.90	98	.01	0.00	.01	0.00	.01	20.40	248	.25	.23	.01	88
1.01	6.95	99	.01	0.00	.01	0.00	.01	20.45	249	.25	.23	.01	88
1.01	7.00	100	.01	0.00	.01	0.00	.01	20.50	250	.25	.23	.01	88
1.01	7.05	101	.01	0.00	.01	0.00	.01	20.55	251	.25	.23	.01	88
1.01	7.10	102	.01	0.00	.01	0.00	.01	21.00	252	.25	.23	.01	88
1.01	7.15	103	.01	0.00	.01	0.00	.01	21.05	253	.25	.23	.01	88
1.01	7.20	104	.01	0.00	.01	0.00	.01	21.10	254	.25	.23	.01	88
1.01	7.25	105	.01	0.00	.01	0.00	.01	21.15	255	.25	.23	.01	88
1.01	7.30	106	.01	0.00	.01	0.00	.01	21.20	256	.25	.23	.01	88
1.01	7.35	107	.01	0.00	.01	0.00	.01	21.25	257	.25	.23	.01	88
1.01	7.40	108	.01	0.00	.01	0.00	.01	21.30	258	.25	.23	.01	88
1.01	7.45	109	.01	0.00	.01	0.00	.01	21.35	259	.25	.23	.01	88
1.01	7.50	110	.01	0.00	.01	0.00	.01	21.40	260	.25	.23	.01	88
1.01	7.55	111	.01	0.00	.01	0.00	.01	21.45	261	.25	.23	.01	88
1.01	7.60	112	.01	0.00	.01	0.00	.01	21.50	262	.25	.23	.01	88
1.01	7.65	113	.01	0.00	.01	0.00	.01	21.55	263	.25	.23	.01	88
1.01	7.70	114	.01	0.00	.01	0.00	.01	22.00	264	.25	.23	.01	88
1.01	7.75	115	.01	0.00	.01	0.00	.01	22.05	265	.25	.23	.01	88
1.01	7.80	116	.01	0.00	.01	0.00	.01	22.10	266	.25	.23	.01	88
1.01	7.85	117	.01	0.00	.01	0.00	.01	22.15	267	.25	.23	.01	88
1.01	7.90	118	.01	0.00	.01	0.00	.01	22.20	268	.25	.23	.01	88
1.01	7.95	119	.01	0.00	.01	0.00	.01	22.25	269	.25	.23	.01	88
1.01	8.00	120	.01	0.00	.01	0.00	.01	22.30	270	.25	.23	.01	88
1.01	8.05	121	.01	0.00	.01	0.00	.01	22.35	271	.25	.23	.01	88
1.01	8.10	122	.01	0.00	.01	0.00	.01	22.40	272	.25	.23	.01	88

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27
28
29
30
31
32
33
34
35
36
37
38
39
40
41
42
43
44
45
46
47
48
49
50
51
52
53
54
55
56
57
58
59
60
61
62
63
64
65
66
67
68
69
70
71
72
73
74
75
76
77
78
79
80
81
82
83
84
85
86
87
88
89
90
91
92
93
94
95
96
97
98
99
100
101
102
103
104
105
106
107
108
109
110
111
112
113
114
115
116
117
118
119
120
121
122
123
124
125
126
127
128
129
130
131
132
133
134
135
136
137
138
139
140
141
142
143
144
145
146
147
148
149
150
151
152
153
154
155
156
157
158
159
160
161
162
163
164
165
166
167
168
169
170
171
172
173
174
175
176
177
178
179
180
181
182
183
184
185
186
187
188
189
190
191
192
193
194
195
196
197
198
199
200
201
202
203
204
205
206
207
208
209
210
211
212
213
214
215
216
217
218
219
220
221
222
223
224
225
226
227
228
229
230
231
232
233
234
235
236
237
238
239
240
241
242
243
244
245
246
247
248
249
250
251
252
253
254
255
256
257
258
259
260
261
262
263
264
265
266
267
268
269
270
271
272
273
274
275
276
277
278
279
280
281
282
283
284
285
286
287
288
289
290
291
292
293
294
295
296
297
298
299
300
301
302
303
304
305
306
307
308
309
310
311
312
313
314
315
316
317
318
319
320
321
322
323
324
325
326
327
328
329
330
331
332
333
334
335
336
337
338
339
340
341
342
343
344
345
346
347
348
349
350
351
352
353
354
355
356
357
358
359
360
361
362
363
364
365
366
367
368
369
370
371
372
373
374
375
376
377
378
379
380
381
382
383
384
385
386
387
388
389
390
391
392
393
394
395
396
397
398
399
400
401
402
403
404
405
406
407
408
409
410
411
412
413
414
415
416
417
418
419
420
421
422
423
424
425
426
427
428
429
430
431
432
433
434
435
436
437
438
439
440
441
442
443
444
445
446
447
448
449
450
451
452
453
454
455
456
457
458
459
460
461
462
463
464
465
466
467
468
469
470
471
472
473
474
475
476
477
478
479
480
481
482
483
484
485
486
487
488
489
490
491
492
493
494
495
496
497
498
499
500
501
502
503
504
505
506
507
508
509
510
511
512
513
514
515
516
517
518
519
520
521
522
523
524
525
526
527
528
529
530
531
532
533
534
535
536
537
538
539
540
541
542
543
544
545
546
547
548
549
550
551
552
553
554
555
556
557
558
559
560
561
562
563
564
565
566
567
568
569
570
571
572
573
574
575
576
577
578
579
580
581
582
583
584
585
586
587
588
589
590
591
592
593
594
595
596
597
598
599
600
601
602
603
604
605
606
607
608
609
610
611
612
613
614
615
616
617
618
619
620
621
622
623
624
625
626
627
628
629
630
631
632
633
634
635
636
637
638
639
640
641
642
643
644
645
646
647
648
649
650
651
652
653
654
655
656
657
658
659
660
661
662
663
664
665
666
667
668
669
670
671
672
673
674
675
676
677
678
679
680
681
682
683
684
685
686
687
688
689
690
691
692
693
694
695
696
697
698
699
700
701
702
703
704
705
706
707
708
709
710
711
712
713
714
715
716
717
718
719
720
721
722
723
724
725
726
727
728
729
730
731
732
733
734
735
736
737
738
739
740
741
742
743
744
745
746
747
748
749
750
751
752
753
754
755
756
757
758
759
760
761
762
763
764
765
766
767
768
769
770
771
772
773
774
775
776
777
778
779
780
781
782
783
784
785
786
787
788
789
790
791
792
793
794
795
796
797
798
799
800
801
802
803
804
805
806
807
808
809
810
811
812
813
814
815
816
817
818
819
820
821
822
823
824
825
826
827
828
829
830
831
832
833
834
835
836
837
838
839
840
84

NAME	DATE	TIME	STAGE	PLT	JPT	INAME	ISTAGE	IAUT
NAME	DATE	TIME	STAGE	PLT	JPT	INAME	ISTAGE	IAUT

COLLUS	CLUES	ALC	INTB	LSAME	INPT	TEMP	LASTB
0.0	0.000	0.00	1	1	0	0	0

	STAGE	600.0	601.4	602.8	604.1	604.7	605.3
FLOW	0.	32.	203.	481.	600.	719.	2692.

CAPACITY	0.	31.	51.	92.	202.
ELEVATION	574.	600.	605.	610.	620.

CREF	SPM10	C10M	FPM*	FLFVL	CNCJ	CARFA	EKPL
400.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0

TYPE	NAME	EXP	NAME
604.5	0.0	0.0	0.0

STATION (NAME)
17, PLANK 1, WATERSHIP 1

SA11WV1(1b) HD78GUB-AM JIJ1637-411-0043

[illegible]

SUMMARY OF PMF AND ONE-HALF PMF FLOOD ROUTING

AND
DAM SAFETY ANALYSIS

PEAK FLOW AND STORAGE DEMAND OF SEWER SYSTEM FOR MULTIPLE QUANTITIES OF WASTEWATER PLANT'S COMPUTATIONS
 PLUMS IN THE CITY OF LOS ANGELES (CUBIC FEET PER SECOND)
 AREA IN SQUARE FEET (SQUARE MILES)

WASTES APPLIED TO PLUMS

OPERATION	STATION	AREA	PLAN	RATIO	WASTE	PLUM
				1.00	1.00	1.00
HYDROGRAPH AT	17	.04	1	.750	1.00	1.00
	(.100	1	1.00	10.700	10.700
ROUTED TO	17	.04	1	.750	1.00	1.00
	(.100	1	0.750	0.750	0.750

NOT FURNISHED TO DDC

SUMMARY OF DAM SAFETY ANALYSIS

PLAN 1									
RATIO OF DEPTH		ELEVATION		INITIAL VALUE		SETBACK COUNT		TIME OF FAILURE	

DATE
ILME
— 88